



LP01-00014 CODE: P ML: H
OCT-72 - PROBLEM: Documentation not adequate for shipping software.
CORRECTION: Obsolete Software List and add Accessory List to the LP01 print set.
In-plant effectivity -06 -Documentation change

LP01-C0015 CODE: F
SEP-73 - PROBLEM: To prevent erroneous zone changes.
CORRECTION: Add Data Products Field Change kit #6328 which implements Data Products ECO's 18367, 18412, and 18478. The reworking involves wiring changes to the 212801-2 back panel: DELETE A005 25 1 to A009 21 1, signal CONT ; ADD A004 37 1 to A009 21 1, signal PFCM . The 212530-1 circuit card, in slot 4 in the card cage assembly, is to be reworked as follows: Cut etch from Z12 pin 9 to Z16 pin 1. Add jumper from Z12 pin 9 to Z18 pin 6 using 30 AWG wire. Add jumper from Z17 pin 2 to connector pin 37 using 30 AWG wire.
In-plant effectivity -None
Field effectivity -Retrofit LP01's at next PM ; serial numbers affected are: 001 thru 1304, 1306 thru 1435, 1438, 1439, 1441 thru 1459, 1461, 1463 thru 1506, 1508 thru 1511, and 1513 thru 1516.
(Time To Install And Test 1.0 Hour.) (Kit Contents -NF1134 - FCO/Prints)